Figure 1

Straight Jack—For Semi-Rigid Cable .250 hex **B** hex **B** hex **B** hex Figure 2 Figure 3 (Direct solder) (Solder-clamp) (One-Step

Dimensions Plating Cable Assembly Procedure Delta P/N **Figure Trim Code** Group **Contact** B **Body** .500 .250 H/01 13 Gold Gold 1308-031-G003-2 13 2 Gold Gold (C) .68 .312 1308-031-G007 *** 13 3 .500 .250 Gold Gold (C) 1308-031-G003-4 I/01 14 1 .500 .250 Gold Gold 1308-094-G003 H/01 14 2 .312 Gold Gold (C) 1308-025-G007 .68 *** Gold (C) 14 3 .500 .250 Gold 1308-094-G003-1 1/01

Panel and Bulkhead Jacks--For Semi-Rigid Cable Figure 1 Figure 2 0 0 (One-Step cable attachment) (Direct solder)

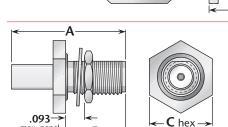


Figure 3 (Direct solder, with mounting gasket)






Figure 4 (Solder-clamp, no mounting gasket)

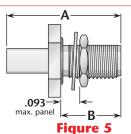


cable attachment)



B

(One-Step cable attachment, with mounting gasket)

Delta One-Step **Cable Attachment** for Semi-Rigid Cable





Delta "One-Step" connectors feature captivated contacts and insulators to allow rapid, easy assembly to semi-rigid cablesimply trim the cable jacket and dielectric flush, chamfer the center conductor, insert into the connector, and solder the jacket to the connector body.

Cable Group	Fig.	Dimensions			Mounting	Plating		Dolto D/N	Assembly Procedure/
		A	В	C	Figure	Body	Contact	Delta P/N	Trim Code
13	1	.560	.375	.065	05	Gold	Gold	1311-031-G053	H/01
13	2	.500	.375	.065	05	Gold	Gold (C)	1311-031-G053-3	I/01
13	3	.75	.415	.437	67	Gold	Gold	1317-031-G673	H/02
13	4	.75	.440	.312	67	Gold	Gold (C)	1317-031-G677	***
13	5	.70	.415	.437	67	Gold	Gold (C)	1317-031-G673-3	I/01
14	1	.500	.375	.065	05	Gold	Gold	1311-025-G053	H/01
14	2	.500	.375	.065	05	Gold	Gold (C)	1311-025-G053-1	I/01
14	3	.75	.415	.437	67	Gold	Gold	1317-025-G673	H/02
14	4	.75	.440	.312	67	Gold	Gold (C)	1317-025-G677	***
14	5	.75	.415	.437	67	Gold	Gold (C)	1317-025-G673-1	I/01

See page 204 for cable groups. • Assembly procedures start on page 205. • ***Contact factory for cable assembly instructions. See page 203 for mounting dimensions. • (C) in contact plating column indicates captive contact.